Possible Damage Causes: ATF pump worn excessively.	Reference RE 1	Possible Damage Causes: Torque converter drains.	Reference RE 4
Manual: III 38-150 153		Manual: III 32-102	
Repair Instructions:		Repair Instructions: Sometimes due to leaking or faulty lubricating pressure ring on drive shaft.	
Code: A 3, G 2		Code: A 4	
Possible Damage Causes: Clutch plates K 1 and/or K 2 worn or burnt.	Reference RE 7	Possible Damage Causes: Idle speed noise from front planet gear set.	Reference RE 9
Manual: III 38-170, 38-178			<u> </u>
Repair Instructions: Premature wear: driver had often driven downhill in selector lever position "N" with the engine running. Burnt liners: replace torque converter. Flush lines and ATF cooler thoroughly.		Repair Instructions: There is hardly no remedy for this. It concerns a noise resulting from manufacturing tolerances. The transmission would have to be almost fully disassembled and the front planet gear set replaced.	
Code: R 7	:	Code: G 5	