

Technical Bulletin

Model
6 Cyl.

Group
4

Subject: Revised Front Wheel Hubs and Tension Ring

Part Identifier
4057

Number
9405

Repairs:

The revised wheel hubs and tension rings are changed in the wheel bearing area (see Figure A, circle). The tension ring is now being centered by the wheel hub and no longer by the bearing ring.

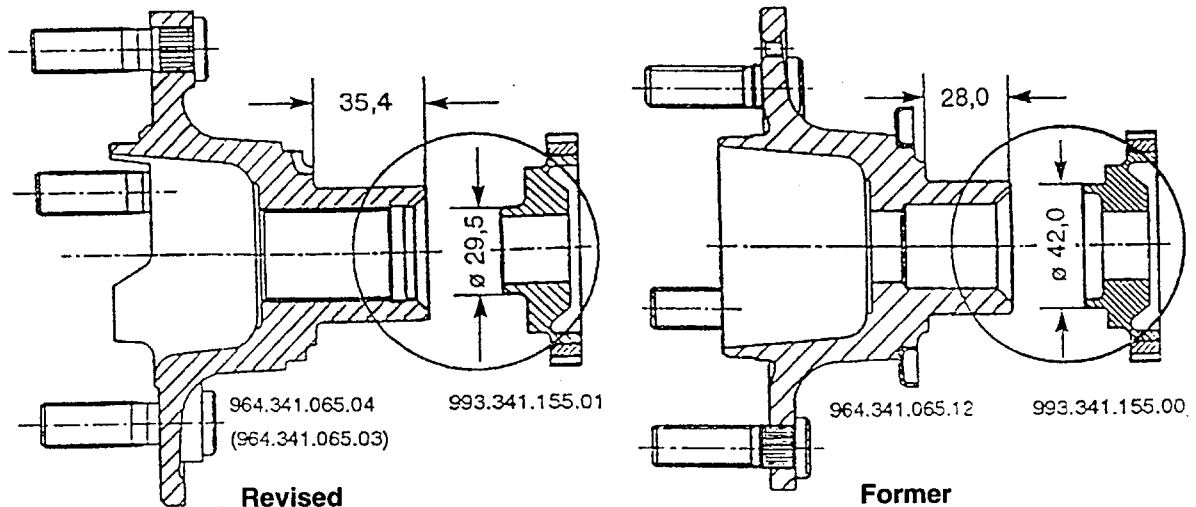


Figure A

If on cars produced before March 7, 1994 introduction date, the wheel hub or the tension ring is being replaced, the correct application of hub and tension ring must be adhered to. See chart below:

Vehicle Type	Wheel Hub	Tension Ring
911 Carrera (993)	964 341 065 03/04	993 341 155 01 (48 teeth)
911 Carrera 4 (964)	964 341 065 03/04	
911 Carrera 2 (964)	964 341 065 12	964 341 155 13 (45 teeth)
911 America Roadster		
911 Turbo (964)		
911 RS America		

NOTE: No other selection is permissible!



PORSCHE
CARS
NORTH
AMERICA
INC.