Technical Bulletin 6 Cyl. 4 Subject: Part Identifier Number 911 Carrera Chassis 4040 9408

ATTENTION: Service Manager / Service Technician

Model Affected:

911 Carrera

Model Year:

1995

Concern:

Some early production 911 Carrera Coupes received different

production suspension components.

General Information:

Below is a list of VIN ranges and the suspension components that are **different** from production components listed in spare parts

microfiche.

Production Version 1:

911 Carrera Coupes produced from December 21, 1993 to January 25, 1994 within the following VIN ranges: 996SS320073 to 992SS320281.

Note: Four vehicles within the above VIN range were equipped with components that were subsequently instituted as Production Version 2. This was done to provide comparison vehicles for production. They are:

994SS320203 993SS320225 998SS320270 991SS320272

The following suspension components installed in Production Version 1 vehicles are different from the components installed in Production Version 3:

| Part Number | Description | |
|--------------------|-------------------------------|--|
| 993 343 041 03 | Left front shock | |
| 993 343 042 03 | Right front shock | |
| 993 343 707 00 | Front stabilizer (21mm) | |
| 964 343 792 18 | Front stabilizer bushing (x2) | |
| 993 333 051 00 | Left rear shock | |
| 993 333 052 00 | Right rear shock | |
| 993 333 701 01 | Rear stabilizer (18mm) | |
| 477 411 313 B | Rear stabilizer bushing (x2) | |
| 993 333 531 07 504 | Rear spring set or | |
| 993 333 531 08 504 | Rear spring set | |



| Technical Bulletin | 6 Cyl. | Group 4 |
|------------------------------|-------------------------|----------------|
| Subject: 911 Carrera Chassis | Part Identifier 4040 | Number 9408 |

Production Version 2:

911 Carrera coupes produced from January 25, 1994 to February 10, 1994 within the following VIN ranges: 994SS320282 to 993SS320418 and also including the four vehicles mentioned in **Note** on page 1 of this bulletin.

The following suspension components installed in **Production Version 2** vehicles are different from the suspension components installed in Production Version 3:

| Part Number | Description | |
|--------------------|-------------------------------|--|
| 993 343 041 01 | Left front shock | |
| 993 343 042 01 | Right front shock | |
| 993 343 707 00 | Front stabilizer (21mm) | |
| 964 343 792 18 | Front stabilizer bushing (x2) | |
| 993 333 051 00 | Left rear shock | |
| 993 333 052 00 | Right rear shock | |
| 993 333 701 01 | Rear stabilizer (18mm) | |
| 477 411 313 B | Rear stabilizer bushing (x2) | |
| 993 333 531 07 504 | Rear spring set or | |
| 993 333 531 08 504 | Rear spring set | |


Production Version 3:

911 Carrera Coupe and Cabriolet produced from February 10, 1994 as of VIN:

995SS320419 990SS320456 99XSS320478 - onward

The following suspension components are installed in **Production Version 3** vehicles:

| Part Number | Description | |
|----------------|-------------------------------|--|
| 993 343 041 06 | Left front shock | |
| 993 343 042 06 | Right front shock | |
| 993 343 707 04 | Front stabilizer (20mm) | |
| 964 343 792 17 | Front stabilizer bushing (x2) | |
| 993 333 051 14 | Left rear shock | |
| 993 333 052 14 | Right rear shock | |

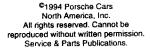



| Technical Bulletin | Model 6 Cyl. | Group 4 |
|------------------------------|-------------------------|----------------|
| Subject: 911 Carrera Chassis | Part Identifier 4040 | Number 9408 |

(Production Version 3 cont'd.)

Part Number

Description

993 333 701 00 477 411 313 B 993 333 531 18 504 993 333 531 19 504

Rear stabilizer (17mm) Rear stabilizer bushing (x2)

Rear spring set or Rear spring set

Repair Procedures:

While each of the above production versions is acceptable, when repairing 911 Carrera Coupe or Cabriolet in Production Version 1 or 2 only Production Version 3 suspension parts are available. The following procedures must be followed when repairing Production Version 1 or 2 vehicles:

- 1. Front or rear shocks. Replace only in pairs.
- 2. Front or rear springs. Replace only in pairs.

SERVICE

3. Front and rear stabilizers. Replace both front and rear stabilizers together along with the necessary bushings.

