

**New Alternator Pulley and Belt**


Binder - Service Technical Bulletins  
This Bulletin replaces bulletin,  
Group 1, # 7/97, dated 7-10-97.

Vehicle Type: **911 Carrera as of M.Y. 1995 and 911 Turbo as of M.Y. 1996**

Model Year: **As of 1995 (S)**

Concern: In case of alternator belt failure or belt noises in conjunction with pulley, part number, 993 106 268 00 (s/s to 993 106 268 01), the alternator belt and pulley must be replaced.

Information: **911 Turbo:**  
When repairs are necessary, install only the new version belt and pulley halves.

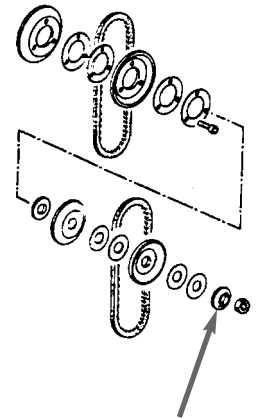

Description	Part Number
New belt (1 ea.)	999 192 372 50 (757 mm long)
Pulley halves (2 ea.)	993 106 268 01 (Yellow, chromated color) *
Shim (0.5 mm)	964 106 268 31 (as required)
Shim (0.7 mm)	964 106 268 32 (as required)

\* The ratio of 2.68 to 1 remains unchanged.

**911 Carrera:**

The new version pulleys can also be installed on the 911 Carrera. However, the previous version belt must be used.

Description	Part Number
Previous belt (1 ea.)	999 192 343 50 (760 mm long)

When installing the new version pulley halves on the 911 Carrera and Turbo, the distance spacer, (see arrow, illustration) is machined as part of the new version pulley and is no longer required. Because of this, it is no longer possible to store adjustment shims behind the distance spacer on the outside of the alternator pulley. Shims removed during the tensioning procedure should be stored in the vehicle tool kit. The tensioning procedure can be found in Repair Group 13, page 13 - 32.

**Important Notice:** Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

©1998 Porsche Cars North America, Inc.

Dealership	Service Manager _____	Shop Foreman _____	Service Technician _____	_____	_____	_____	_____
Distribution	Asst. Manager _____	Warranty Admin. _____	Service Technician _____	_____	_____	_____	_____
Routing							

The trademarks Porsche®, Targa®, Carrera®, Boxster®, Tiptronic®, Varioram® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.