



SERVICE

Date	Invoice #
11/19/2021	8739

Bill To
Clay Condry

Ship To
Clay Condry

VIN#	Mileage	Terms	Vehicle
WP0AD299X8S783477	47113		2008 997 TURBO SILVER

Description	Qty	Rate	Amount
labor to install customer provided tubi exhuaast system	1	625.00	625.00
customer says boost numbers are down according to tuner and fuel trims are high, checked vacuum lines at fuel pressure regulator, installed fuel injection clamps at that locating. looked around intake with fiber optic camera for vacuum leaks or hoses disconnected. boost checked intercooler system with plugs and regulators, no leaks found. smoke test system found leak at t between diverters, repaired leak at vacuum t.	5	90.00	450.00
Inspection found rear brake pad sensosrs touching rotor and rotors had large wear lip .		0.00	0.00
labor to install new pads rotors and sensors	1	180.00	180.00
Rear rotor OEM left list \$305.54	1	244.32	244.32T
Rear rotor OEM right list \$305.54	1	344.32	344.32T
rear brake pads OEM list \$296.77	1	237.41	237.41T
rear brake pad sensors OEM list \$51.77	2	41.41	82.82T
discount labor credit	1	-600.00	-600.00

Subtotal	\$1,563.87
Sales Tax	\$74.98
Total	\$1,638.85
Payments/Credits	\$0.00
Balance Due	\$1,638.85

Phone #
405-330-9116