



Continental Imports

European Auto Specialists



(352) 377-6604 1219 S Main St Gainesville FL 32601
 (352) 377-2218 fax www.continentalimports.com

Invoice Number	240219
Order Date	12/06/2022
MV	MV11119
Advisor	Michael B
Date In	12/06/2022
Date Out	

[Redacted]	VIN Number	Fleet ID	License Plate	Prod Date
	WP0CA29849S710311		[Redacted]	
	Year	Make	Model	Color
	2009	Porsche	BOXSTER	Silver
	Engine	Mileage In		Tag
	B6, 2.9L	95,092		

Work Performed And Parts Used

Disposal
 Labor Fee Qty Part Cost

***** Customer Concerns *****
 Check

0.00

Job Total \$0.00

CONTIMPO

Check clutch issue - TOW in

1,649.03

Check clutch issue when driving where clutch is slipping and there is vibrations when engaging and releasing clutch. Inspected to find the dual mass flywheel has failed and the clutch disc is severely worn and the pressure plate has also failed. Remove and replace the complete clutch kit with clutch disc, pressure plate, release bearing, dual mass flywheel and all new hardware for clutch. While in the same area, we replaced the engine rear main seal and cleaned the area.

9G2 114 012 02	Dual Mass Flywheel	1	1,459.03
FREIGHT	Freight In	1	56.40
0PB 105 249	Seal- Crankshaft (flywheel) 85 X 105 X 11mm	1	38.18
987 116 913 26	Clutch Kit	1	706.98
N 906 651 01	Bolt 25p Flywheel	10	58.20
9A7 004 076 00	Bolt- Pressure Plate	6	6.42
61/HARDWARE	Shop Supplies Nuts/bolts/cleaners/adhesives/etc.	4	13.00
		Parts Total	2,338.21
CT		Job Total	\$3,987.24

Found high psi Pwr Steering leak

373.78

Found power steering leak from high pressure hose. Remove and replace power steering hose and refill system with new fluid. Bleed system and clean area. Test drive car to verify repairs.

997 347 451 14	Pressure Line	1	483.36
FREIGHT	Freight In	1	6.00
000 043 305 74	Fluid- Power Steering	1	28.87
107CAN	Cleaner- General Purpose -by 14 Oz Can	1	7.25
61/HARDWARE	Shop Supplies Nuts/bolts/cleaners/adhesives/etc.	1	3.25
		Parts Total	528.73
CT		Job Total	\$902.51

Replace crankshaft position sensor

229.87

Found on test drive the engine ECM will lose crankshaft position signal and the tachometer will jump around and lose rpm signal due to failing sensor. This causes the vehicle to run rough and misfire at high rpms. Remove and replace crankshaft position sensor and clear fault codes. Then test drive to verify repairs.

0 261 210 300	Impulse Sender	1	124.35
FREIGHT	Freight In	1	27.06

Taxable Labor	2252.68
Taxable Parts	3018.35
SubTotal	5271.03
Sales Tax	368.97
Charges	5640.00
Balance Due	5640.00