

PORSCHE CARS NORTH AMERICA, INC.

Technical Bulletin	Model 928 S4	Group 2
	Subject: Calibrating Fuel Level System	Part Identifier 2015

Model Year 1989

If instrument display "Fuel Reserve" is inaccurate or the fuel tank, fuel level sender or instrument cluster is replaced, the fuel level system must be calibrated.

Calibrating procedures:

1. Fill a completely drained fuel tank with precisely 15 liters (3.96 gallons) of gasoline.
2. Wait at least one minute.
3. Pull back the operating lever of the backlighted instrument cluster (Fig. 1) and turn on the ignition switch simultaneously until

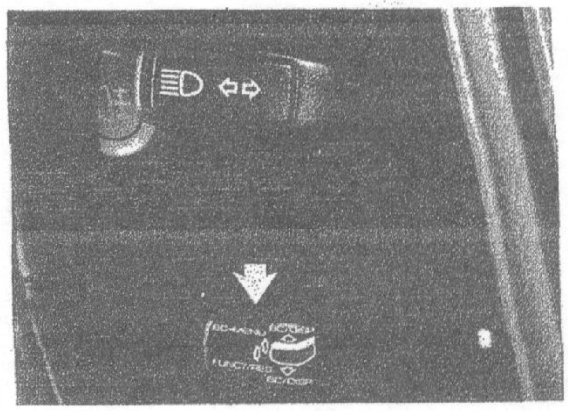


Figure 1



is displayed in instrument cluster.

4. Press the zero button (Fig. 2) until the number 15 appears in the center display box.

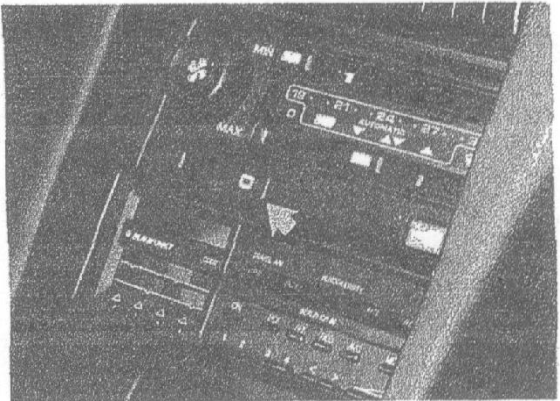


Figure 2


This indicates fuel level system is calibrated.

Calibrating procedures are stopped by turning off the ignition or starting the engine.

Important Notice

PCNA Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

©1988 Porsche Cars North America, Inc.



SERVICE