

Technical Bulletin

Model
928


Group
15

Subject: Camshaft/Sealing


Part Identifier
1505/06

Number
78-03

Camshaft/spacers have been modified for improved sealing.

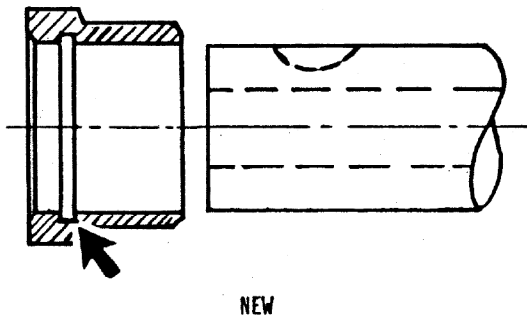

O-ring has been moved from camshafts to spacers (arrow).

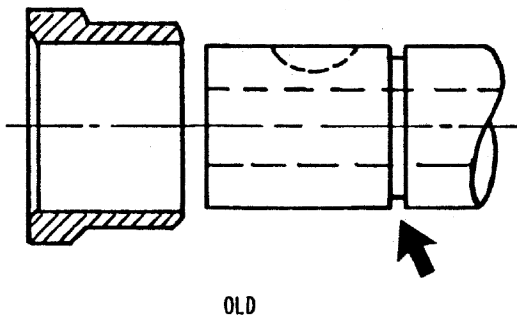

New-type camshafts no longer have groove (arrow).

New-type camshafts are installed in engines from following engine numbers:

- manual transmission 828 0082
- automatic transmission 828 9026

New-type spacers with O-ring can be installed on old-type camshafts.

New-type camshafts can be installed in earlier engines using following parts:

Caution

When new-type camshafts are installed in earlier engines, matching bearing carrier must be modified

Parts required

Left side:

camshaft	No. 928 105 156 07
spacer	No. 928 105 143 02
O-ring (for spacer)	No. 999 701 592 40

Right side:

camshaft	No. 928 105 155 07
spacer	No. 928 105 139 02
O-ring (for spacer)	No. 999 701 592 40

Bearing carrier, modifying

Caution

When new-type camshaft is installed in earlier engine or when replacing bearing carrier on new-type camshaft, bearing carrier chamfer must be modified. Otherwise, camshaft will not have sufficient end play

SERVICE

Page 1 of 2
June 14, 1978