



**PORSCHE**

## Certificate of Authenticity

The Porsche vehicle with the identification number listed below was manufactured with the following assembly specifications:

**WPOAC29937S792667**

**Model Year/Type**

2007 911 GT3

**Production Completion Date**

3/22/2007

**Manufacturer's Suggested  
Retail Price (MSRP)**

USD 113,745.00

**Engine/Transmission Type**

M97/76/G97/90

**Exterior Paint Color/Code**

Guards Red Top/G1

Guards Red Top/G1

**Interior Material Color/Type**

Black Full Leather/78

**Optional Equipment**

Dashboard Stitching Dev. Color

Door Stitching in Dev. Color

Door Handle Stitching Dev.Clr.

Seat Stitch Deviating Clr. GT3

Floor Mats - Interior Color

U.S. Standard/Emissions


Xenon Headlamp Package

Heated Front Seats

Self-Dim Mirrors & Rain Sensor

Seat Belts - Guards Red

Peter Schwarzenbauer  
President and Chief Executive Officer

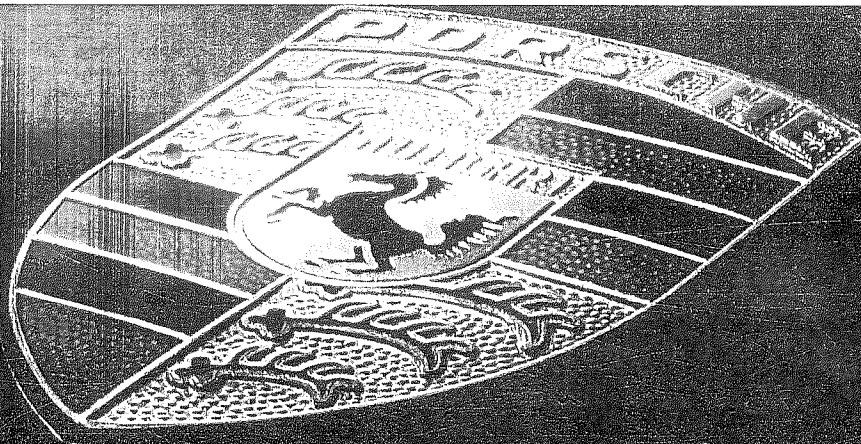

**STANDARD EQUIPMENT**

**Technical/Mechanical**

Horizontally opposed 6 cylinder, 3.6 liter  
 415 HP, 300 Lb Ft torque  
 Water cooled w/ alloy block & cylinder heads  
 Dry sump lubrication w/ external oil tank  
 Titanium connecting rods  
 Double overhead cams w/ 4 valves per cyl  
 VarioCam variable valve timing  
 2 stage resonance induction system  
 Sports exhaust w/ 2 center tailpipes  
 Cylinder specific anti-knock control  
 6 speed manual trans w/ oil cooler  
 Locking differential w/ asymmetric ratio  
 Traction Control w/ ABD, ASR & MSR  
 McPherson Strut Front Suspension  
 Multi-link LSA Rear Suspension  
 Stabilizer bars, Front & Rear  
 PASM - Porsche Active Susp. Management  
 13.78" vented & cross drilled brake rotors,  
 6 piston calipers - F, 4 piston calipers - R  
 Brakepad wear indicators on each pad  
 8.5x19 alloy wheels w/ 235/35ZR19 tires - F  
 12x19 alloy wheels w/ 305/30ZR19 tires - R

**Passive Safety/Environment**

LEV II (Low Emission Vehicle) status  
 Body shell hot dip galvanized on both sides,  
 w/ high strength steel & Boron steel safety  
 structures. Aluminum trunk lid & doors.  
 POSIP - Porsche Side Impact Protection  
 including front airbags, Thorax airbags  
 in seats, head airbags in doors, (6 total)  
 Front belt pre-tensioners & force limiters  
 Exhaust system made of Stainless Steel

**Comfort/Convenience**

Sport seats w/ alcantara inlays, alcantara  
 steering wheel, height & reach adjustable  
 Power Rack & Pinion steering w/ vario ratio  
 TPM - Tire Pressure Monitoring  
 Power tilt and slide sunroof  
 CDR24 AM/FM/CD radio w/ 4 loudspeakers  
 Full climate control w/ active carbon filter  
 Cruise Control  
 Remote entry alarm w/ interior surveillance  
 Weight reduced battery  
 Reduced noise insulation materials  
 On Board Computer, 17.7 gal tank

**OPTIONS**

Manufacturer's Suggested Retail Price:

Porsche Base Model 106,000  
 Guards Red N/C  
 Guards Red Top N/C  
 Black Full Leather 2,995  
 U.S. Standard/Emissions N/C  
 Self-Dim Mirrors & Rain Sensor 690  
 Bi-Xenon Headlamp Package 1,090  
 Seat Belts - Guards Red 540  
 Heated Front Seats 480  
 Floor Mats - Interior Color 140

EXCLUSIVE OPTIONS 1,810  
 Destination Charge 860  
**TOTAL PRICE\*** 114,605

*P03235*

\*Gasoline, license and title fees, state and local taxes and dealer installed options and accessories are not included.

**EXCLUSIVE OPTIONS**

Manufacturer's Suggested Retail Price:

Dashboard Stitching Dev. Color  
 Door Stitching in Dev. Color  
 Door Handle Stitching Dev.Clr.  
 Seat Stitch Deviating Clr. GT3

\*\*\*\*\*

**Ask about finance and lease options available through Porsche Financial Services.**

**INVOICE**

Print Date : 02/11/2010

2007 Porsche - 911 GT3

3.6L, H6, VIN (A)

Lic # : H95 0162

Odometer In : 16072

Unit # :

Odometer Out : 16073

Vin # : **WP0AC29937S792667**

Hat # :

~~3-23-2010~~  
~~1-15-2010~~  
~~Home 044-707-0769~~  
 Cust ID : 392

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
GT3 Porsche Factory Harness Bar. Customer has harnesses. 997.580.986.02	1.00	2,378.95	2,378.95	Remove front seats, center console, cut carpet & drill roll bar floor plates next to B-pillars behind seats, install harness bar, install seat harnesses for driver's seat only, then re-install center console & seats. Clear	880.00
Freight for harness bar.	1.00	89.00	89.00	airbag light.	
Freight					
Shop Supplies		7.00	7.00		
				FOUR WHEEL ALIGNMENT - Check - Both Axles	99.00
				FOUR WHEEL ALIGNMENT - Adjustment - [DOES NOT include straightening or replacing of parts.]	341.00
				Hazardous Materials	7.00

[ Technicians : Cushman, Drew 3; Swales, Matt; Moore, Kent 1 ]

Org. Estimate \$14.57	Revisions \$0.00	Current Estimate \$ 14.57	Additional Cost	Revised Estimate	<b>Labor: 1,327.00</b>
					<b>Parts: 2,474.95</b>
					<b>Sublet: 0.00</b>
					-----
					<b>Sub: 3,801.95</b>
					<b>Tax: 200.47</b>
					<b>Total: 4,002.42</b>
					<b>Bal Due: \$1,623.47</b>

[ Payments - MasterCard - \$2378.95 ]

Warranty on OEM parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Motorsport Parts & Services are for competition use only & carry no warranties expressed or implied.

SIGNATURE..... Date..... Time.....

# Longacre



Longacre Automotive Racing Products Redmond, Wa.

Date	2   11   10
Track	Neutral
Car #	2007 997 6T3
Motor	3.6 Litre

## Chassis Sheet

### LF

### RF

Spg.	Shock	Height	Wheel Wt.
Stock	Stock	106 mm	619 lbs.

Wheel Wt.	Height	Shock	Spg.
581 lbs.	105 mm	Stock	Stock

Tire:	Pressure	Sizes
Cold	34 psi	235/35 2R19
Hot	40-44 psi	"

Tire:	Pressure	Sizes
Cold	34 psi	235/35 2R19
Hot	40-44 psi	"

Tire:	Make	Comp.
	Michelin	Pilot Sport


Tire:	Make	Comp.
	Michelin	Pilot Sport

• • Tire Temperatures • •			
Outside	10	Center	11
Even		Across	Tire

• • Tire Temperatures • •					
Inside	3	Center	2	Outside	1
Even		Across		Tire	

<b>Camber</b>	2.2°
<b>Caster</b>	2.6°

<b>2.2° Camber</b>
<b>2.6° Caster</b>

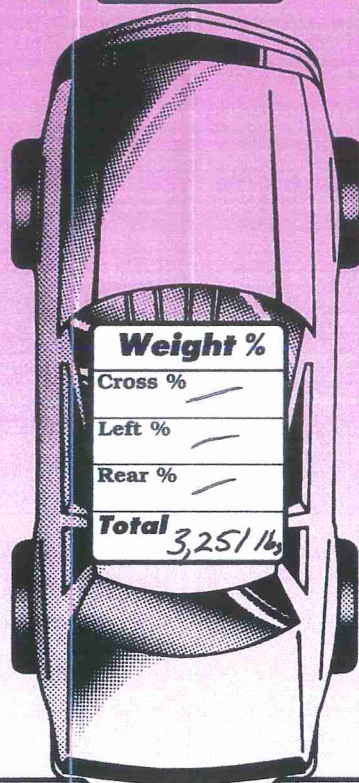

Weight %	
Cross %	
Left %	
Rear %	
<b>Total</b>	3,251 lbs.

### LR

### RR

• • Tire Temperatures • •			
Outside	7	Center	8
Even		Across	Tire

• • Tire Temperatures • •					
Inside	6	Center	5	Outside	4
Even		Across		Tire	

Spg.	Shock	Height	Wheel Wt.
Stock	Stock	117 mm	1,013 mm

Wheel Wt.	Height	Shock	Spg.
1,038 mm	117 mm	Stock	Stock

Tire:	Pressure	Sizes
Cold	36 psi	305/30 2R19
Hot	40-44 psi	"

Tire:	Pressure	Sizes
Cold	36 psi	305/30 2R19
Hot	40-44 psi	"

Tire:	Make	Comp.
	Michelin	Pilot Sport

Tire:	Make	Comp.
	Michelin	Pilot Sport

**Weather:**      **Temp:**      **Track Condition:**      **Times:**

Notes: Sway bar - Front - 1 off full soft.  
Rear - Full stiff.

**PREMIER SPORTSCAR SERVICE INC.**  
 4005 W. Dewey Drive  
 Las Vegas, Nevada. 89118  
 Phone - 702-649-8267 Fax - 702-641-1661  
 www.premiersportscarservice.com

INVOICE

**2150**

Org. Est. # 004095  
105655

**INVOICE**

Print Date : 03/25/2011

<p><del>██████████</del>  <del>██████████</del>  <del>██████████</del>          Cust ID : 392</p>	<p>2007 Porsche - 911 GT3          3.6L, H6, VIN (A)          Lic # : H95 0162                      Odometer In : 28564          Unit # :                                      Odometer Out : 28565          Vin # : <b>WP0AC29937S792667</b>          Hat # :</p>
Ref # :	

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
Flywheel 964.102.239.31	1.00	677.72	677.72	CLUTCH PRESSURE PLATE - Remove & Replace - [DOES NOT include resurface flywheel. See Machine Operations. Includes: R&I engine where necessary.] - GT3	935.00
Crankshaft Seal - Rear 997.102.264.91	1.00	111.02	111.02		
Pilot Bearing 931.102.111.00	1.00	17.97	17.97	Fill & Bleed Cooling System.	88.00
Ring Gear 964.114.143.31	1.00	230.53	230.53	(Combination) CLUTCH RELEASE BEARING - Remove & Replace	22.00
Release Bearing 944.116.080.01	1.00	218.51	218.51		
Release Arm Bushing 950.116.715.01	2.00	4.75	9.50	(Combination) CRANKSHAFT OIL SEAL - Remove & Replace - Rear	55.00
Release Bearing Guide Tube 950.116.813.30	1.00	125.60	125.60	(Combination) FLYWHEEL - Remove & Replace	44.00
Flywheel Bolt 928.102.151.01	9.00	3.81	34.29	Repair damaged left rear wheel outer lip.	150.00
Pressure Plate Bolt N 014 715 3	9.00	0.90	8.10	Hazardous Materials	7.00
Clutch Disc 996.116.015.32	1.00	573.64	573.64		
Pressure Plate 996.116.027.51	1.00	686.29	686.29		
Clutch Lever Bearing 999.201.365.00	1.00	8.38	8.38		
Clutch Lever Bearing 999.201.339.00	1.00	8.38	8.38		
15-24mm - Aluminum/Zinc 15-24mm - Hose Clamp 30024	1.00	2.05	2.05		
Clutch Lever Shaft Seal 999.113.418.40	2.00	2.10	4.20		
Genuine Porsche Anti-Freeze Coolant 000.043.301.05	2.00	36.54	73.08		
MOBIL 1 0W-40 SYNTHETIC MOTOR OIL MOBIL 1	2.00	7.75	15.50		
Brake & Parts Cleaner 189099107	2.00	4.20	8.40		

**PREMIER SPORTSCAR SERVICE INC.**  
 4005 W. Dewey Drive  
 Las Vegas, Nevada. 89118  
 Phone - 702-649-8267 Fax - 702-641-1661  
 www.premiersportscarservice.com

INVOICE

**2150**

Org. Est. # 004095  
 105655

**INVOICE**

Print Date : 03/25/2011

2007 Porsche - 911 GT3

3.6L, H6, VIN (A)

Lic # : H95 0162

Odometer In : 28564

Unit # :

Odometer Out : 28565

Vin # : **WP0AC29937S792667**

Hat # :

Cust ID : 392

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
Freight for parts					
Freight	1.00	8.49	8.49		
Porsche Windshield Clearshield, Suntek 4 milAG					
Clearshield	1.00	150.00	150.00		
Shop Supplies		7.00	7.00		

[ Technicians : Moore, Kent 1; Sublet, Tech ]

Org. Estimate \$3,872.26    Revisions \$0.00    Current Estimate \$ 3,872.26    Additional Cost    Revised Estimate

<b>Labor:</b>	<b>1,301.00</b>
<b>Parts:</b>	<b>2,978.65</b>
<b>Sublet:</b>	<b>0.00</b>
-----	
<b>Sub:</b>	<b>4,279.65</b>
<b>Tax:</b>	<b>241.27</b>
<b>Total:</b>	<b>4,520.92</b>
<b>Bal Due:</b>	<b>\$4,520.92</b>

[ Payments - ]

Warranty on OEM parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our facility & cannot exceed the original cost of repair. Motorsport Parts & Services are for competition use only & carry no warranties expressed or implied.

SIGNATURE..... Date..... Time.....

# Eurosport Racing

3671 Patterson Rd  
 Joliet IL 60436  
 815-727-5577  
 EurosportRacing.com / Premier PORSCHE Service for 27 years.

Page: 1  
 Repair Order  
 3200

Year: 07 Make: Porsche Model: 997 GT3  
 Vin Number: [REDACTED] License: [REDACTED] Mileage: 30687  
 Disposition: [REDACTED]

Quan	Part Number/Description	Price
4.0	75-90 MOBIL Gear Lube 996 D	43.04
1.0	POR. ANTIFFREZE Porsche A/F, Gal	34.99
1.0	996-302-911-71 Ring & Pinion 9	2,756.96
1.0	997-302-901-91 1st & 2nd Gear	1,497.87
1.0	999-113-326-41 Main Shaft Seal	21.00
1.0	999-707-328-40 O-ring -Trans s	12.64
1.0	999-059-066-02 Taper roller be	91.02
1.0	999-059-064-00 Tapered Bearing	91.02
1.0	999-110-132-01 Cyl.Roller Bear	493.16
3.0	928-304-211-30 Synchro Ring ST	221.23
1.0	928-304-211-23 Synchro Ring	142.98
1.0	999-034-033-00 Trans Nut	10.50
1.0	999-034-035-00 Locking Nut 22*	16.84
1.0	999-034-034-00 Shouldered Nut	16.84
1.0	999-110-194-01 Bearing - Front	563.22
2.0	950-304-617-20 Friction ring 1	138.42
2.0	996-304-613-20 Conical ring 1s	70.91
2.0	950-304-611-20 Synchro Ring	151.03
1.0	996-304-061-50 Shift sleeve 1-	368.30
1.0	999-052-164-00 Roller bearing	242.81
1.0	996-304-021-51 Guide sleeve AS	397.92
2.0	999-113-347-40 flange shaft se	25.44
1.0	FREIGHT Priority	400.00
2.0	999-217-027-01 Drive flange bo	8.30
1.0	2707 RS-29 02-07 GT3/Cup F	429.00

Parts: 9,073.70

Oper: 01  
 Repair Instructions: Trans Remove & Reinstall  
 Trans Remove & Reinstall. Remove clutch measure & inspect, replace if required. Rear main add .5  
 Refill trans, pump, cooler. Purge air from cooling system & refill.  
 450.00

02  
 Repair Instructions: Transmission Rebuild 997 TL  
 Dis-assemble trans., clean and inspect all parts for excessive wear or damage. Replace all syncros all gaskets and seals and other parts as required.  
 Additional time for setting up new Ring & Pinion 5hr  
 2500.00

03  
 Repair Instructions: Diff. take apart & rebuild  
 200.00

04  
 Repair Instructions: Coolant or burn smell in Front  
 Pressure test system, check for leaks, No coolant leak was found  
 60.00

05  
 Repair Instructions: Brake Pads Frt Replace  
 Remove and Replace front pads. Also check rotors for abnormal wear.  
 90.00

Recommendations:

We at Eurosport Racing  
 Thank You for allowing  
 us to service your car!

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

1 08/31/1113221.28 Check 1233 9:10 am

(Signature) \_\_\_\_\_

Quotes:




Total Labor: 3,300.00  
 Total Parts: 9,073.70  
 Supply/Waste: 99.00  
 Subl Repair: 0.00  
 Tax: 748.58  
 Total Amount: 13221.28  
 Payments: 13221.28  
 Bal Due: .00

2318

105655

INVOICE

Print Date : 01/30/2012

L  
  
  
 Home Phone:   
 Cust ID : 392

Ref # :

2007 Porsche - 911 GT3  
 3.6L, H6, VIN (A)  
 Lic # : H95 0162 Odometer In : 32885  
 Unit # : Odometer Out : 32886  
 Vin # : WP0AC29937S792667  
 Hat # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
Brake Disc - Rear Left 997 352 405 02	1.00	222.18	222.18	DISC ROTOR - Remove & Replace - [Includes: Replace pads if necessary] - Rear, Both Sides	220.00
Brake Disc - Rear Right 997 352 406 02	1.00	222.18	222.18		
Pagid RS19 997 Cup rear brake pads U8006	1.00	360.36	360.36	Drill out stripped threads that holds left rear brake caliper & install a heli-coil.	110.00
Freight for brake pads. Freight	1.00	28.10	28.10	Install New Front Splitter.	55.00
12 X 1.5 Heli- Coil Heli-Coil	1.00	8.00	8.00	Hazardous Materials	7.00
Front Spoiler Lip 997.505.983.92	1.00	342.01	342.01		
Freight for spoiler lip. Freight	1.00	8.00	8.00		
Shop Supplies		7.00	7.00		

[ Technicians : Moore, Kent 1; Swales, Matt; Cobian, Eric ]

Org. Estimate \$1,134.85	Revisions \$0.00	Current Estimate \$ 1,134.85	Additional Cost	Revised Estimate	<b>Labor:</b> 392.00
					<b>Parts:</b> 1,197.83
					<b>Sublet:</b> 0.00
					-----
					<b>Sub:</b> 1,589.83
					<b>Tax:</b> 97.02
					<b>Total:</b> 1,686.85
					<b>Bal Due:</b> \$1,686.85

[ Payments - ]

Warranty on OEM parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our facility & cannot exceed the original cost of repair. Motorsport Parts & Services are for competition use only & carry no warranties expressed or implied.

SIGNATURE..... Date..... Time.....



DESERT PERFORMANCE  
 MOTORSPORTS  
 77-897 WILDCAT DR.  
 PALM DESERT, CA 92211

# Invoice

Date	Invoice #
11/27/2012	1068

Bill To

Ship To

S.O. No.	P.O. No.	Terms	Project
00956			

Item	Description	Ordered	Prev. Invo...	Invoiced	U/M	Rate	Amount
labor	Oil Change	0.5	0	0.5		130.00	65.00
SCHAEFFER	SCHAEFFER 5W-30 WT	8	0	8		9.95	79.60T
OX1281D	OIL FILTER	1	0	1		27.56	27.56T
sublet	Sublet Repair- Alignment	1	0	1		130.00	130.00
labor	Remove seat belt and install seat	2	0	2		130.00	260.00
MTP-91	INTERSTATE BATTERY	1	0	1		163.95	163.95T
99992406401	BUSH	1	0	1		4.09	4.09T
99902802201	SPRING WASHER	1	0	1		2.21	2.21T
81185784501C	BOLT CAP	1	0	1		2.12	2.12T
labor	Install Battery	0.5	0	0.5		130.00	65.00
99634144190	CONTROL ARM	2	0	2		79.62	159.24T
99634112190	CONTROL ARM	1	0	1		211.86	211.86T
99634112290	CONTROL ARM	1	0	1		211.86	211.86T
labor	Install control arms	2	0	2		130.00	260.00
Deposit	Deposit against work to be performed	1	0	1		-715.73	-715.73

<b>Subtotal</b>		\$926.76
<b>Sales Tax (8.75%)</b>		\$75.47
<b>Total</b>		\$1,002.23
<b>Payments/Credits</b>		\$0.00
<b>Balance Due</b>		\$1,002.23



**PORSCHE of Beachwood**

25855 Chagrin Blvd.  
 Beachwood, Ohio 44122  
 Telephone: (216) 763-4911  
 Fax: (216) 763-4898

I ACKNOWLEDGE AND APPROVE EXTRA WARRANTY REPAIRS PERFORMED AS NEEDED.		CUST. INITIAL		THANK YOU FOR THIS OPPORTUNITY TO SERVICE YOU. IT IS OUR AIMS TO PERFORM ALL THE REPAIRS REQUESTED ON THIS REPAIR ORDER TO YOUR COMPLETE SATISFACTION. IF OUR SERVICE WAS SATISFACTORY TELL YOUR FRIENDS. IF NOT, PLEASE TELL US IMMEDIATELY.			
SIGNED: X CUSTOMER NO. 12250		ADVISOR PAT		TAG NO. 101 DK		INVOICE DATE 02/28/13	INVOICE NO. POCS7351
		LABOR RATE		LICENSE NO.		MILEAGE 34,443	COLOR GUARDS RED/
		YEAR / MAKE / MODEL 07/PORSCHE/911 CARRERA/2DR CPE		DELIVERY DATE 05/12/07		DELIVERY MILES	
		VEHICLE I.D. NO. W P O A C 2 9 9 3 7 S 7 9 2 6 6 7		SELLING DEALER NO.		PRODUCTION DATE	
		F.T.E. NO.		P.O. NO.		R.O. DATE 02/12/13	
RESIDENCE PHONE		BUSINESS PHONE 830-379-4926		COMMENTS			MO: 34445

ESTIMATE-----  
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING ORIGINAL ESTIMATE OF \$13553.00 (+TAX)

COMMENTS-----  
 ADDED TO SYSTEM  
 PCA MEMBER DISCOUNTS APPLIED

TOTALS-----

*****	TOTAL LABOR....	3699.00
*	TOTAL PARTS....	8431.62
* [ ] CASH [ ] CHECK CK NO. [ ] *	TOTAL SUBLET...	0.00
*	TOTAL G.O.G....	250.00
* [ ] VISA [ ] MASTERCARD [ ] DISCOVER *	TOTAL MISC CHG.	29.62
*	TOTAL MISC DISC	-583.34
* [ ] AMER XPRESS [ ] OTHER [ ] CHARGE *	TOTAL TAX.....	916.59
*****	<b>TOTAL INVOICE \$</b>	<b>12743.49</b>

CUSTOMER SIGNATURE \_\_\_\_\_

The Reynolds and Reynolds Company PRAIRIEVILLE CO. (06/11)



PORSCHE

PORSCHE of Beachwood

25855 Chagrin Blvd.
Beachwood, Ohio 44122
Telephone: (216) 763-4911
Fax: (216) 763-4898

Form with fields: I ACKNOWLEDGE AND APPROVE EXTRA WARRANTY REPAIRS PERFORMED AS NEEDED, CUST. INITIAL, SIGNED: X, CUSTOMER NO. 12250, ADVISOR PAT, TAG NO. 101 DK, INVOICE DATE 02/28/13, INVOICE NO. POC57351, LABOR RATE, LICENSE NO., MILEAGE 34,443 GUARDS RED/, YEAR / MAKE / MODEL 07/PORSCHE/911 CARRERA/2DR CPE, DELIVERY DATE 05/12/07, VEHICLE I.D. NO. WP0AC29937S792667, SELLING DEALER NO., F.T.E. NO., P.O. NO., R.O. DATE 02/12/13, RESIDENCE PHONE, BUSINESS PHONE B30-379-4926, COMMENTS, MO: 34445

JOB# 1 CHARGES-----
LABOR-----
# 1 12POZ ENGINE MAJOR TECH(S):927 1464.00
REQUEST REWORK COOLANT PIPES
R/R ENGINE/TRANS AND REMOVED AND REEPOXY ALL EXTERNAL COOLANT PIPE FITTINGS. ALSO PERFORM MAJOR MAINT WHILE ENGINE WAS OUT. R/R SPARK PLUGS/IGN COILS/FUEL FILTER/OIL&FILTER/CLEANED AIR FILTER/WIPER BLADES. INSTALLED WEVO MOTOR MOUNTS BEFORE REINSTALLING ENGINE AND TRANS ALSO REPLACED BROKEN FRONT TRANNY MOUNT.

Table with columns: PARTS, QTY, FP, NUMBER, DESCRIPTION, LIST PRICE, UNIT PRICE. Includes items like ADHESIVE, O-RING, TRANSMISSION CAR, FUEL FILTER M33, SPARK PLUG, IGNITION COIL W., ANTIFREEZE 3.79, PENTOSIN CHF202, OIL-FILTER INSER, ALUM SEAL RING, PUMP SEAL, COPPE, MOB-IL-ONE, WIPER BLADE. Total - PARTS: 1553.60

G.O.G. & SUPPLIES-----
FREIGHT (PARTS) 250.00
TOTAL - GOG 250.00

MISC-----CODE-----DESCRIPTION-----CONTROL NO-----
10P 10% PARTS DISCOUNT -155.36
10L 10% LABOR DISCOUNT -146.40
TOTAL - MISC -301.76

JOB# 1 TOTALS-----
LABOR 1464.00
PARTS 1553.60
G.O.G. 250.00
MISC -301.76

JOB# 2 CHARGES-----
# 2 45POZ STEERING/SUSPENSION TECH(S):927 732.00
REQUEST SWAP LOWER CONTROL ARMS

JOB# 1 JOURNAL PREFIX POC5 JOB# 1 TOTAL 2965.84
PAGE 1 OF 5 CUSTOMER COPY [CONTINUED ON NEXT PAGE] 05:53pm



PORSCHE

# PORSCHE of Beachwood

25855 Chagrin Blvd.  
Beachwood, Ohio 44122  
Telephone: (216) 763-4911  
Fax: (216) 763-4898

I ACKNOWLEDGE AND APPROVE EXTRA WARRANTY REPAIRS PERFORMED AS NEEDED.		CUST. INITIAL		THANK YOU FOR THIS OPPORTUNITY TO SERVICE YOU. IT IS OUR AIM TO PERFORM ALL THE REPAIRS REQUESTED ON THIS REPAIR ORDER TO YOUR COMPLETE SATISFACTION. IF OUR SERVICE WAS SATISFACTORY TELL YOUR FRIENDS, IF NOT, PLEASE TELL US IMMEDIATELY.			
SIGNED: X CUSTOMER NO. 12250		ADVISOR PAT	101	TAG NO. DK	INVOICE DATE 02/28/13	INVOICE NO. POCS7351	
[REDACTED]		LABOR RATE	LICENSE NO.	MILEAGE 34,443	COLOR GUARDS RED/	STOCK NO.	
[REDACTED]		YEAR / MAKE / MODEL 07/PORSCHE/911 CARRERA/2DR CPE			DELIVERY DATE 05/12/07	DELIVERY MILES	
[REDACTED]		VEHICLE I.D. NO. W P O A C 2 9 9 3 7 S 7 9 2 6 6 7			SELLING DEALER NO.	PRODUCTION DATE	
[REDACTED]		F.T.E. NO.		P.O. NO.	R.O. DATE 02/12/13		
RESIDENCE PHONE	BUSINESS PHONE 830-379-4926	COMMENTS				MO: 34445	

OB# 4 CHARGES-----

LABOR-----  
# 4 47POZZO AXLE CONCERN TECH(S):927 732.00  
REQUEST REPLACE ALL 4 WHEELS BEARINGS  
INSTALLED BOTH REAR WHEEL BEARING, FIXED A STRIPPED OUT CALIPER BOLT HOLE ON THE RT REAR CARRIER, INSTALLED TPC ADJUSTABLE REAR TOE LINKS, AND INSTALLED WHEEL STUDS AND NEW LUGS ON EVERY HUB

ARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	LIST PRICE-	UNIT PRICE-	PRICE-
	2	999-053-054-06	ANGULAR-CONTACT	119.28	99.40	198.80
	2	999-053-055-02	ANGULAR BALL BEA	127.49	121.95	243.90
	1	9395	TIME-SERT	56.85	56.85	56.85
TOTAL - PARTS						499.55

ISC-----	CODE-----	DESCRIPTION-----	CONTROL NO-----	PRICE-
	10P	10% PARTS DISCOUNT		-49.96
	10L	10% LABOR DISCOUNT		-73.20
TOTAL - MISC				-123.16

OB# 4 TOTALS-----  
LABOR 732.00  
PARTS 499.55  
MISC -123.16

JOB# 4 JOURNAL PREFIX POCS JOB# 4 TOTAL 1108.39

OB# 5 CHARGES-----

LABOR-----  
# 5 45POZ06 4 WHEEL ALIGNMENT TECH(S):927 225.00  
CUSTOMER REQUESTS 4 WHEEL ALIGNMENT  
PERFORM 4 WHEEL TRACK ALIGNMENT, REALIGN VEHICLE TO CUSTOMER REQUESTED TRACK SETTINGS, TEST DROVE AND VERIFIED THAT THE VEHICLE WAS TRACKING/HANDLING PROPERLY

OB# 5 TOTALS-----  
LABOR 225.00

JOB# 5 JOURNAL PREFIX POCS JOB# 5 TOTAL 225.00

OB# 6 CHARGES-----

LABOR-----  
# 6 60POZ11 SEAT BELTS TECH(S):927 183.00  
REQ INSTALL 6 PT HARNESSES  
INSTALLED CUSTOMER PROVIDED GT3RS SPORT BUCKETS AND SCROTH 6PT HARNESS'S

ARTS-----	QTY----	FP-NUMBER-----	DESCRIPTION-----	LIST PRICE-	UNIT PRICE-	PRICE-
	2	SR91127A-0	SCHROTH-GT3 BELT	630.30	535.10	1070.20
TOTAL - PARTS						1070.20

ISC-----	CODE-----	DESCRIPTION-----	CONTROL NO-----	PRICE-
	10L	10% LABOR DISCOUNT		-18.30



PORSCHE

# PORSCHE of Beachwood

25855 Chagrin Blvd.  
Beachwood, Ohio 44122  
Telephone: (216) 763-4911  
Fax: (216) 763-4898

I ACKNOWLEDGE AND APPROVE EXTRA WARRANTY REPAIRS PERFORMED AS NEEDED.		CUST. INITIAL		THANK YOU FOR THIS OPPORTUNITY TO SERVICE YOU. IT IS OUR AIM TO PERFORM ALL THE REPAIRS REQUESTED ON THIS REPAIR ORDER TO YOUR COMPLETE SATISFACTION. IF OUR SERVICE WAS SATISFACTORY TELL YOUR FRIENDS. IF NOT, PLEASE TELL US IMMEDIATELY.			
SIGNED: X CUSTOMER NO. 12250		ADVISOR PAT		TAG NO. 101 DK		INVOICE DATE 02/28/13	INVOICE NO. POCS7351
		LABOR RATE		LICENSE NO.		MILEAGE 34,443	COLOR GUARDS RED/
		YEAR / MAKE / MODEL 07/PORSCHE/911 CARRERA/2DR CPE		DELIVERY DATE 05/12/07		STOCK NO.	
		VEHICLE I.D. NO. W P O A C 2 9 9 3 7 S 7 9 2 6 6 7		SELLING DEALER NO.		DELIVERY MILES	
RESIDENCE PHONE		BUSINESS PHONE 830-379-4926		P.O. NO.		R.O. DATE 02/12/13	PRODUCTION DATE
COMMENTS		MO: 34445					

JOB# 6 TOTALS-----  
 TOTAL - MISC -18.30  
 LABOR 183.00  
 PARTS 1070.20  
 MISC -18.30

JOB# 7 CHARGES-----  
 JOB# 6 JOURNAL PREFIX POCS JOB# 6 TOTAL 1234.90

LABOR-----  
 # 7 46POZ WHEELS/TIRES TECH(S):927 180.00  
 REQ SET OF WHEELS  
 MOUNT AND BALANCE 4 WHEELS/TIRES

PARTS	QTY	FP-NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	PRICE
	2	18x8.5	OZ HLT WHEEL	444.00	444.00	888.00
	2	18x12	OZ HLT WHEEL	490.00	490.00	980.00
	2	2653518	BFG G-FORCE TIRE	315.00	315.00	630.00
	2	3353018	BFG G-FORCE TIRE	339.00	339.00	678.00
	20	TCKPRO	STUDS	15.55	15.55	311.00
	20	TCK	NUTS	4.00	4.00	80.00
TOTAL - PARTS						3567.00

JOB# 7 TOTALS-----  
 LABOR 180.00  
 PARTS 3567.00

JOB# 8 CHARGES-----  
 JOB# 7 JOURNAL PREFIX POCS JOB# 7 TOTAL 3747.00

LABOR-----  
 # 8+40POZ12 RENEW BRAKE FLUID TECH(S):927 122.00  
 BRAKE FLUSH SERVICE  
 PERFORM BRAKE FLUSH WITH CASTROL SRF FLUID

PARTS	QTY	FP-NUMBER	DESCRIPTION	LIST PRICE	UNIT PRICE	PRICE
	1	SRF	BRAKE FLUID	100.00	100.00	100.00
TOTAL - PARTS						100.00

MISC-----  
 CODE-----DESCRIPTION-----CONTROL NO-----  
 10L 10% LABOR DISCOUNT  
 TOTAL - MISC -12.20

JOB# 8 TOTALS-----  
 LABOR 122.00  
 PARTS 100.00  
 MISC -12.20

JOB# 8 JOURNAL PREFIX POCS JOB# 8 TOTAL 209.80

MISC-----  
 CODE-----DESCRIPTION-----CONTROL NO-----  
 JOB # A EPA ENVIRONMENTAL WASTE  
 TOTAL - MISC 29.62

The Reynolds and Reynolds Company ERNINTIVE C08880X Q (06/11)



330-425-8582  
 Fax: 330-425-3560  
 2002 Midway Drive  
 Twinsburg, OH 44087  
 steinels@windstream.net

Inc.

Name: [Redacted]  
 Address: [Redacted]  
 City/State/Zip: [Redacted]  
 Year, Make, & Model: [Redacted]  
 Serial No./V.I.N.: W-0AC29937S792667  
 Date In: 6-13-17  
 Date Promised: [Redacted]  
 Cell phone #: 330-618-8866  
 Email address: [Redacted]  
 Phon: [Redacted]  
 Mileage: 40,958

Disassemble front and rear braking systems. Replace front caliper piston dust boots, inspect ceramic spacers. Clean pad transfer from rotors. Install supplied front and rear pads. Perform brake and clutch flush. Road test for braking performance.

Remove wheels and clean. Mount and balance four provided tires with new weights. Road test for vibration, torque wheels. Clean air filter, reset service reminder.

$$\begin{array}{r}
 -2.3 \quad -2.6 \\
 + \\
 -2.0 \quad -2.0 \\
 \hline
 \end{array}$$

NOTE:  
 One horn is inop.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic a lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, sale, repair or while road testing

AUTHORIZED BY \_\_\_\_\_

Date \_\_\_\_\_

(Airt new unless otherwise specified)			
4	AW MISC	38mm Caliper Dust Boot	\$43.20
4	AW MISC	32mm Caliper Dust Boot	\$43.20
4	AW MISC	28mm Caliper Dust boot	\$43.20
0.5	Castrol SRF	Hydraulic Fluid	\$37.50
<b>TOTAL PARTS</b> \$167.10 <b>TOTAL LABOR</b> \$765.00 <b>Shipping</b> <b>Shop Supplies</b> \$24.00 <b>SubTOTAL</b> \$979.05 <b>TAX</b> \$66.09 <b>TOTAL</b> \$1,045.14			

The undersigned ("Owner") hereby declares the following agreement and makes acknowledgment of Steinel's Autowerks ("Autowerks") disallows as stated below:  
 1. Owner has requested certain services and equipment modifications to Owner's auto, which Autowerks has agreed to perform in a workmanlike manner. However, as indicated to Autowerks to perform said services and equipment modifications, Owner has and hereby acknowledges that the performance and service provided may or will not meet any factory warranty and may adversely affect the auto's performance, crash worthiness, reliability or durability under some use conditions.  
 (b) Some of the modifications requested may not or do not conform to Federal EPA regulations or Federal or state environmental or safety laws and may make  
 (c) No representations are made by Autowerks regarding the effect any of the modifications may have on the value of the auto.  
 2. Acknowledging the foregoing, as a part of the consideration paid for Autowerks' services, Owner hereby agrees that Autowerks, its employees, principals, officers, and agents harmless from any and all claims or third party claims, including but not limited to, claims for breach of contract, warranty, safety, longevity, legality or value, and owner will indemnify Autowerks, from any claim made against it by any third-party in privity with Owner.

Any warranties on the products sold hereby are those made by the manufacturer. The seller (above named dealer) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

Thank You





Steinel's Autowerks  
 2002 Midway Dr  
 Twinsburg, OH 44087  
 (330) 425-8582  
 Steinel's.com

# Quote #243

Created: 5/10/2018



2007 Porsche 911 GT3  
 Vin # | WP0AC29937S792667

Recommendations
Front rotors nearing end of life. Change from carbotec in near future?

Track Prep						
	Description	Price	QTY	HRS	Disc	Subtotal
1	Drain oil, replace filter cartridge. Fill with Mobil One and top all fluids. Inspect drive line and suspension components.					\$165.00
2	Oil Filter	\$19.57	1			\$19.57
3	OW40 Mobil One Oil	\$8.85	9			\$79.65
4	Perform Nut & Bolt Torque of steering and suspension systems. Load vehicle onto trailer after wash.					\$130.00

Please call with any questions!

Signature \_\_\_\_\_

Total Parts .....	\$99.22
Total Labor .....	\$295.00
Subtotal .....	\$394.22
Shop Supplies .....	\$8.85
EPA .....	\$0.99
Taxes .....	\$25.62
<b>Grand Total .....</b>	<b>\$429.68</b>
Paid To Date .....	(\$0.00)
<b>REMAINING BALANCE</b>	<b>\$429.68</b>





Steinels Autowerks  
 2002 Midway Dr  
 Twinsburg, OH 44087  
 (330) 425-8582  
 Steinels.com

# Quote #600

Created: 8/28/2018



2007 Porsche 911 GT3 (Red)

VIN: WPOAC29937S792667

Mileage In: 44,288

Mileage Out: 44,585

### Recommendations

1 Horn inop

### Suspension

	Description	Price	QTY	HRS	Disc	Subtotal
1	Replace shocks with supplied parts: Determine missing parts and order. Remove front and rear Moton strut and canister assemblies. Plug holes in tube from reservoir line routing. Assemble and install supplied struts and remaining parts of strut assemblies. Remove RF passengers compartment trim, remount and code in PASM control unit. Road test to settle, prep for alignment.					\$1,350.00
2	Alignment					\$220.00
3	Coil Spring Set / Front GT3	\$330.39	1			\$330.39
4	Coil Spring Set / Rear GT3	\$798.14	1			\$798.14
5	Shock Bellows / Rear GT3	\$13.55	2			\$27.10
6	Shock Snubber / Rear GT3	\$52.13	2			\$104.26
7	Shock Bellows / Front GT3	\$20.74	2			\$41.48
8	Shock Top / Front GT3	\$78.39	2			\$156.78
9	Spring Hanger / Rear GT3	\$76.13	2			\$152.26
10	Rubber Pad / Rear GT3	\$12.81	2			\$25.62
11	Support Mount / Rear GT3	\$180.61	2			\$361.22
12	Washer / Strut	\$7.30	2			\$14.60
13	Lock Nut / Strut	\$9.35	2			\$18.70
<b>Subtotal:</b>						<b>\$3,782.70</b>

### Tires

	Description	Price	QTY	HRS	Disc	Subtotal
1	Mount and balance four supplied tires with new weights. Place in supplied bags.					\$140.00
<b>Subtotal:</b>						<b>\$153.65</b>

### Engine

	Description	Price	QTY	HRS	Disc	Subtotal
1	Oil Service: Drain oil, replace filter cartridge. Fill with Mobil One and top all fluids. Perform nut and bolt service. Inspect braking system mechanics and					\$165.00



Steinels Autowerks  
 2002 Midway Dr  
 Twinsburg, OH 44087  
 (330) 425-8582  
 Steinels.com

# Quote #600

Created: 8/28/2018

hydraulics. Read control units for fault codes. Road test for drivability and performance. Set hot oil level.					
2	0W40 Mobil One Oil	\$8.85	9		\$79.65
3	Oil Filter	\$19.57	1		\$19.57
4	Drain coolant from block, pipes, and front radiators. Fill with water / Water Wetter mixture and bleed system.				\$405.00
5	Water Wetter	\$17.20	1.5		\$25.80
6	O-Ring / Coolant Hose	\$5.31	2		\$10.62
<b>Subtotal:</b>					<b>\$771.73</b>

Suspension						
	Description	Price	QTY	HRS	Disc	Subtotal
1	LR Wheel bearing play. With suspension apart, remove and replace LR wheel bearing.					\$270.00
2	Wheel Bearing / Rear 997		1			\$0.00
3	Axle Nut	\$9.65	1			\$9.65
4	Lock Nut / Suspension	\$2.40	1			\$2.40
<b>Subtotal:</b>						<b>\$309.31</b>

Please call with any questions!

Signature

Total Parts .....	\$2,178.24
Total Labor .....	\$2,550.00
Subtotal .....	\$4,728.24
Shop Supplies .....	\$76.50
EPA .....	\$21.79
Taxes .....	\$190.86
<b>Grand Total .....</b>	<b>\$5,017.39</b>
Paid To Date .....	(\$0.00)
<b>REMAINING BALANCE</b>	<b>\$5,017.39</b>