

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 01/28/2011 @ 10:56

Model Year: 1986	Make: PORSCHE	Model: 928
License: 928DYA	State: CO	VIN: WPOJB0928HS861364
Engine Size: 5.0 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3500	Cylinders: 8
Odometer: 111263	Certification: Federal	VLT Record #: 18710
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration

Overall Test Results

Comprehensive Visual Inspection: **PASS** Functional Check: **PASS** Emissions Test: **FAIL**

Repairing your vehicle is necessary to help California reduce smog-forming emissions and reach our air quality goals.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	N/A	MIL/Check Engine Light
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional	N/A	Ignition Timing:	Pass	Other Emission Related Components
N/A	Fuel Cap Functional	N/A	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Pass			
N/A	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1259	12.5	3.7	128	41	53	0.80	0.13	0.02	1106	399	1913	FAIL
25 mph	2055	12.0	4.2	103	29	32	0.60	0.11	0.01	936	332	920	PASS

MAX = Maximum Allowable Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Failed smog check? Financial assistance may be available. To get an application, visit the Bureau of Automotive Repair's website at www.smogcheck.ca.gov or call toll-free at 800.952.5210.

Si usted ha fallado el examen de smog, asistencia financiera puede estar disponible. Para obtener una solicitud, visite www.smogcheck.ca.gov o llámenos a BAR al 800.952.5210.

No match has been found or test has been performed offline. The Consumer is responsible for retaining the VIR for reference throughout the vehicle registration process.

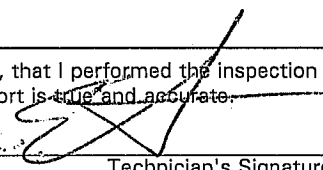
Smog Check Inspection Station Information

Whitmore's Auto Service
1701 Buena Vista Ave. Alameda, Ca. 94501
(510) 523-4222
Station Number: RM074547

Technician Name/Number: ESTIGOY, STEVEN/EA303922
Repair Tech Name/Number:
Software Version/EIS Number: 0903/ES315387

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

1/28/11
Date


Technician's Signature